

DATE: 7 DECEMBER 1972
FROM: A. BELANGER
SUBJECT: NOVA 1200 TTY TEST REV. 04
AND HIGH SPEED READER PUNCH
TEST REV. 03 ERRORS

NUMBER: S1000
CATEGORY: SOFTWARE
MODEL: 4010

Nova 1200 TTY test 095-000045-04:

The TTY test was updated from Rev. 03 to Rev. 04 to incorporate the ability to run this diagnostic with crystals other than 150 baud.

Rev. 04 will not run properly if the device code used is 50. It will fail on starting addresses 40 and 42. Rev. 05 corrects this error.

If a Rev. 03 tape is used, change location 000052 from 002455 to 003017. Rev. 02 of this diagnostic functions properly.

High Speed Reader Punch Test 095-000014-03:

This diagnostic was updated from Rev. 02 to Rev. 03 for the same reason as above. Rev. 03 will fail on the punch or read floating ones test. Rev. 04 corrects this error.

To use the Rev. 03 tape change:

<u>Location</u>	<u>From</u>	<u>To</u>
000060	000135	000664
000061	000136	000707

Rev. 02 of this diagnostic functions properly.